

VISUAL DIFFERENCES IN BELT TENSIONER 55760

TECHNICAL INFO NO. 1034

VEHICLE MANUFACTURER/MODELS:

Audi	A6, 80
Ford	Galaxy
Seat	Alhambra, Cordoba, Ibiza II, Inca, Toledo
VW	Caddy II, Golf III, Golf IV, Passat, Polo, Sharan, Vento, Transporter T4

APPLIES TO ENGINES:

1.7 D, 1.7 SDI, 1.9 D, 1.9 SDI, 1.9 TDI, 2.4 D, 2.5 D

APPLIES TO PART NO.:

	RUVILLE-No.	OE-No.:
Ford	55760	95VW-10145-DA, 1039808
VW		028 903 315 R (new) 028 903 315 N (replaced)

IMPORTANT NOTE!

The bolts (M8x35) supplied by RUVILLE must be used due to the greater flange thickness of the belt tensioner 55760 (Image 1).

Note the specifications of the vehicle manufacturer!

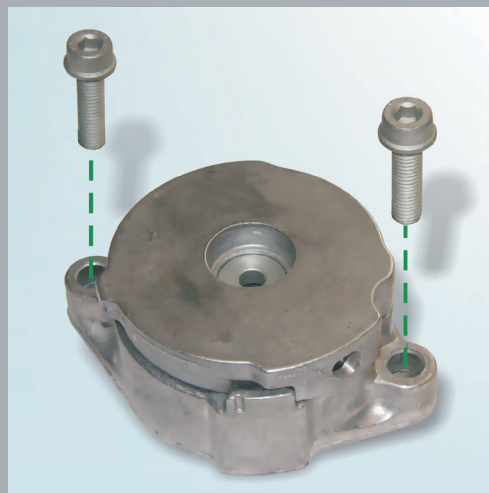


Image 1: Design with two M8x35 bolts

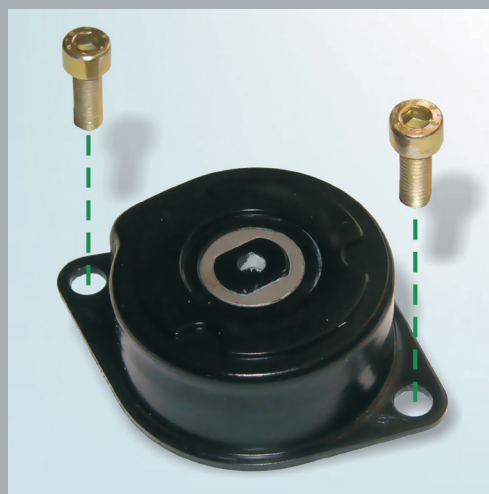


Image 2: Design with two M8x22 bolts

When replacing the belt tensioner 55760, the versions shown can be installed on the vehicle. RUVILLE currently offers the version shown in Image 1.

Both versions conform to technical requirements.



INFORMATION

Corresponding spare parts can be found in our online catalogue at www.ruville.de. Where reference is made to the spare parts numbers of the vehicle manufacturers, this is only for the purposes of comparison.